

AIRPRO™ X4000 PNEUMATIC GOUGING TORCH & CABLE ASSEMBLY

FEATURES & BENEFITS

EASY TO LOAD

- Uses compressed air to raise and lower the upper arm; no force required to load/unload electrodes

SIMPLE OPERATION

- To gouge, press the rocker switch and slide lock forward to lock in place to begin the airflow through the torch assembly; simply slide the lock back and release the rocker switch to stop

NO LEAKS

- Positive air valve to eliminate compressed air from leaking

POSITIVE GRIP HANDLE

- Greater operator feel and ease in positioning the torch

DURABLE FRONT INSULATORS

- High impact and heat resistance protecting the torch metal parts



PNEUMATICALLY OPERATED

upper arm for ease of inserting/adjusting the carbon electrode in the torch head assembly.

ROCKER SWITCH

allowing the insertion/adjustment of the carbon electrode and compressed air on/off. No air flow through the torch and cable assembly without initiating flow through the rocker switch

PATENT PENDING



HIGH IMPACT,
heat resistant insulators

LOWER PROFILE
and positive grip handles

AIRPRO™ X4000

Introducing the next generation air carbon-arc metal removal torch and cable assembly, AirPro X4000. The unique, patent-pending, pneumatically operated upper arm and air valve design eliminates air leakage through the torch and cable when turned off, making this torch assembly the best in the market.



COMFORTABLE AND EASY TO USE

- Ship and Offshore Yards
- Civil Construction
- Pipe Construction
- Repair and Maintenance
- Heavy Fabrication
- Industrial and General Fabrication
- Mining
- Steel Erectors

AMPERAGE RANGE

- 90 – 1000 amps

ELECTRODE SIZE


- Pointed – 5/32" – 1/2" round (4.0 mm – 12.7 mm)
- Jointed – 5/16" – 1/2" round (7.9 mm – 12.7 mm)
- Flat – 3/8" and 5/8" (9.5 mm – 15.9 mm)
- Half Round – 5/8" (15.9 mm)

AIR REQUIREMENTS

- psi – 80
- kg/cm2 – 5.6
- cfm – 25
- l/min – 708

Part No.	Description
61-084-009	AirPro X4000 Torch & Cable Assembly 7 ft. (2.1 m) – 360° Swivel & Insulated Hook-up Kit

SWIVEL CABLE ASSEMBLY

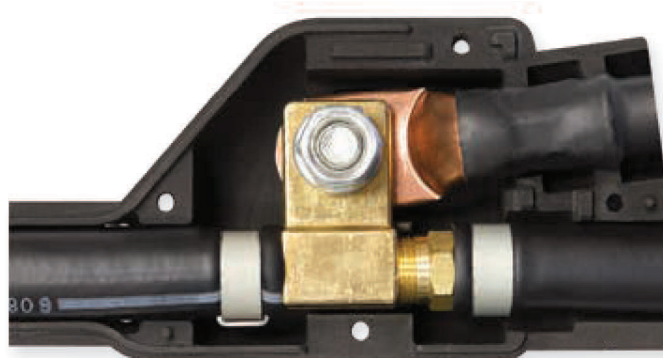

Part No.	Description
01-084-002	AirPro X4000 Torch Only
70-084-407	7 ft (2.1 m) 360° Swivel Cable
94-463-046	Quick Connect Hook-Up Kit

